
floor drain DallDrain Select Plan, DN 40, 120 x 120 mm

Part number: 517104
GTIN: 4001636517104
Rebate group: 6



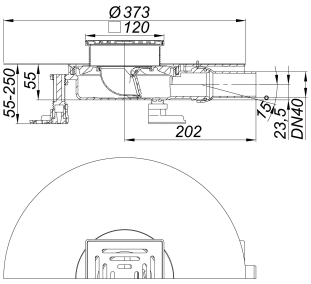

Description:

floor drain DallDrain Select Plan, DN 40, 120 x 120 mm
Floor drain including grating DallDrain Select with stainless steel grate in stainless steel frame. Side outlet DN 40, with ball joint, adjustable from 0 – 15 degrees.

Specification
– Stainless steel grate and frame
– Integrated screed anchoring
– Flexible, click-in sealing sleeve for secure connection to bonded and
sheet waterproofing conforming to DIN 18534
– Fully removable, two-piece trap insert and rodding eye, 22 mm water seal
(deviating to DIN EN 1253)
– Temporary blanking plate
– Three sound-insulated mounting feet for fixing and height adjustmen 55 – 250 mm
– Spigot can be shortened for floorings 10 – 36 mm (including adhesive)
– Screed reinforcement element for protection of the outlet

Material
Drain body and outlet polypropylene, highly impact-resistant; 1.4301 stainless steel grating, load class K 3 (300 kg); spigot in ABS, frame in 1.4301 stainless steel
Pre-assembled set consisting of parts no. 517296 + 517227 + 517340.

Grating with positioning aid laterally adjustable +/- 9.5 mm.
Can be used with sound insulation mat DallDrain (art. no. 517326) and

mounting aid DallDrain Plan (art. no. 517302).
Can be connected to British standard pipework with adaptor part No. 880734.

Flow rates tested to DIN EN 1253:

Nominal diameter	Product standard	Min. flow rate according to norm	Water level according to norm	Flow rate at water level 10 mm	Flow rate at water level 20 mm	Drainage capacity
DN 40	DIN EN 1253	0.40 l/s	20.00 mm	0.47 l/s	0.54 l/s	0.54 l/s

DALLMER

Spare parts:

501080	grate E 115, 115 x 115 mm
517296	grating DallDrain Select, 120 x 120 mm
517340	mounting feet DallDrain
517364	trap insert DallDrain Plan
517197	sealing sleeve DallDrain

Dallmer GmbH + Co KG · Wiebelsheidestraße 25 · 59757 Arnsberg · Tel.: +49 2932 9616-0 · Fax: +49 2932 9616-222
www.dallmer.com · info@dallmer.de
Subject to modifications due to technical development, errors and misprints